

Parking

Locations		Non-Compliant Infraction		Compliant Remediation Procedure/Modification to Ensure Program Access		Criteria- ADAAG Architectural Barrier Removal Priorities						Supplemental Technical Information			
Locations		Identified Issue	ADAAG / AGODA Specifications	Recommended Corrections		Priority #1	Priority # 2	Priority #3	Priority # 4	PROWAG	Recommended	Photo #	Conceptual Costs	Date to be corrected	Date Completed (Include Initials)
Parking		1. Five (5) parking spaces are provided. A handicap accessible parking space does not exist. Cross slopes of the parking spaces provided exceed 2% and are measureable up to 6.3%. Parking spaces are not clearly marked or defined.	ADAAG 206, 502, 703	1. Regrade parking spaces ensuring cross slopes do not exceed 2% max. in any direction. Provide one handicap accessible parking space. Handicap accessible parking space shall be van accessible. Van accessible parking spaces shall be 132" min. wide with a 60" min. wide access aisle located immediately adjacent to the parking space it serves and shall extend the full length of the parking space. Install an accessible parking sign designating accessible parking space as "van accessible". Parking sign shall be mounted at 60" min. AFF. as measured to the bottom edge of the sign and shall be located directly in front of the parking space it serves.											

Exterior Accessible Route

Locations		Non-Compliant Infraction		Compliant Remediation Procedure/Modification to Ensure Program Access		Criteria-ADAAG Architectural Barrier Removal Priorities						Supplemental Technical Information			
Locations		Identified Issue	ADAAG / AGODA Specifications	Recommended Corrections		Priority #1	Priority #2	Priority #3	Priority #4	PROWAG	Recommended	Photo #	Conceptual Costs	Date to be corrected	Date Completed (Include Initials)
Accessible Route		1. An accessible route does not exist connecting to all amenities at the park. The parking lot is used as an accessible route.	ADAAG 403	1. Pave or regrade an accessible route connecting Van Accessible parking space to all amenities within the park. Accessible route shall be firm, stable, and slip-resistant, 36" min. wide with cross slopes not exceeding 2% max. and running slope not exceeding 5% max.											
Picnic Tables		1. Two (2) picnic tables are provided. One is measured to be 29" x 60" table top surface with a 28 1/2" knee clearance. The other table is measured to be 30 1/2" x 72" table top surface with a knee clearance of 26 1/2" on one end and 27 1/2" on the other. Neither picnic table provides accessible seating. An accessible route does not exist connecting to the picnic tables. Picnic tables do not provide a 48" min. long by 30" min. wide clear forward approach. 2. A level 48" by 48" clear ground space is not provided in front of trash receptacle opening. An accessible route does not exist connecting to trash receptacle.	AGODA 1011.2, 1011.4	1. Provide or replace an existing table with accessible picnic table containing at least one wheelchair space 30" min. wide by 48" min. long. Provide a clear ground space of 36" min along all usable sides of the table. 2. Provide a 36" min. by 48" level paved surface located in front of trash receptacle opening. Paved surface should have cross slopes not exceeding 2% max. Paved surface shall adjoin an accessible route.											

Boat Launch

Locations	Non-Compliant Infraction		Compliant Remediation Procedure/Modification to Ensure Program Access	Criteria-ADAAG Architectural Barrier Removal Priorities						Supplemental Technical Information			
Locations	Identified Issue	ADAAG / AGODA Specifications	Recommended Corrections	Priority #1	Priority # 2	Priority #3	Priority # 4	PROWAG	Recommended	Photo #	Conceptual Costs	Date to be corrected	Date Completed (Include Initials)
Boat Launch	1. Running slopes of boat launch exceed 10% and are measureable up to 17.2%. The walking surface is rough with many variations in level and grade. Concrete surface has eroded away from weather and natural elements over time.	ADAAG 403, 504, 505	1. Repave section of the boat ramp ensuring walking surface is firm, stable, and slip resistant. Newly paved walking surface shall be 48" min. wide with a landing provided at the top and bottom sections of the accessible route. Ensure cross slopes do not exceed 2%. Ensure running slope does not exceed 8.33% max. if handrails are provided and are mounted at 34"-38" max. AFF. as measured to the top of gripping surface.										